


2020 Buick Truck Enclave AWD V6-3.6L

Vehicle > Powertrain Management > Ignition System > Spark Plug > Service and Repair > Removal and Replacement

SPARK PLUG REPLACEMENT (BANK 1)

Document ID: 4757062

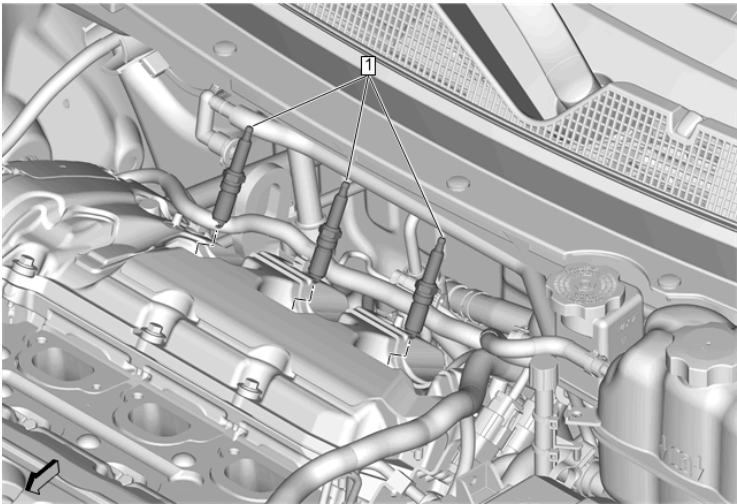

Callout	Component Name
Preliminary Procedure	
Ignition Coil Replacement - Bank 1	
1	Spark Plug [3x] Caution: Refer to Component Fastener Tightening Caution. Procedure 1. If reusing the spark plugs, inspect for wear or damage. Spark Plug Inspection 2. If using NEW spark plugs, do NOT attempt to check the spark plug gap. The plugs come pre-gapped. Tighten 18 Nm (13 lb ft)