


2020 Buick Truck Enclave AWD V6-3.6L

Vehicle > Powertrain Management > Ignition System > Spark Plug > Service and Repair > Removal and Replacement


INTAKE MANIFOLD DISASSEMBLE

Document ID: 2202553


1. Remove the throttle body bolts (1).

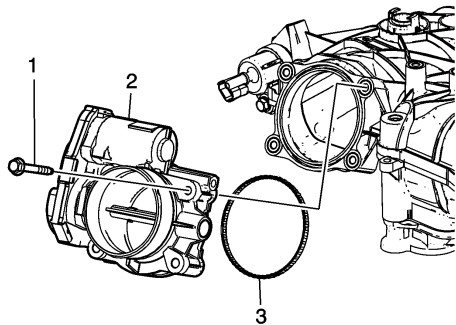


2. Remove the throttle body (2).
3. Remove and discard the throttle body seal (3).
4. Loosen the evaporative (EVAP) solenoid bolt.

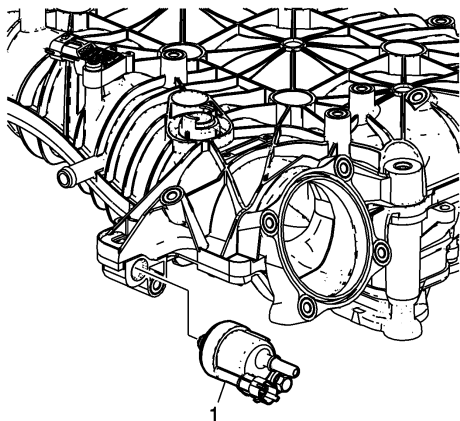

5. Remove the EVAP solenoid (1).
6. Remove the manifold absolute pressure (MAP) sensor bolt (1).

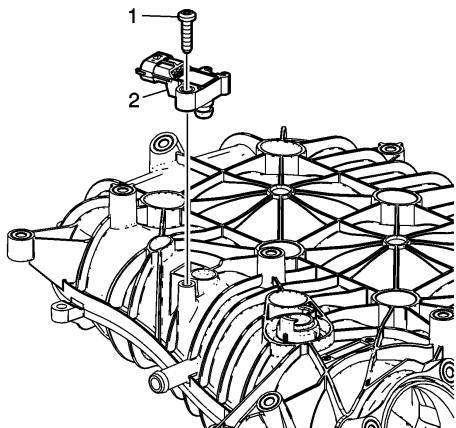

7. Remove the MAP sensor (2).
8. Remove the lower intake manifold bolts (1) and lower intake manifold (2).

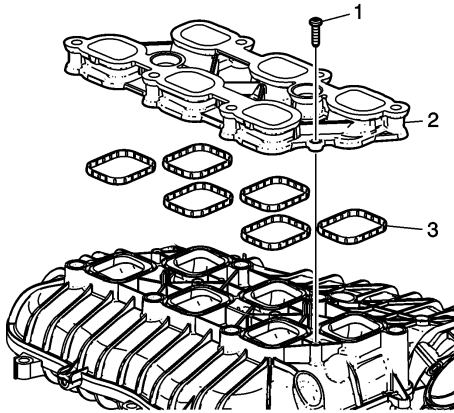

9. Remove and discard the lower intake manifold gaskets (3).
10. Remove and discard the plastic compression limiters (1).

